




Replace Reservoir Cap - HD-T533

Model No.	No.	ltem	Description	Part No.
HD-T533	1	Reservoir Kits	HM1.0 reservoir cap & gasket, Left	ABOT001049
	2		HM1.0 reservoir cap & gasket, Right	ABOT001048

I. Replace reservoir cap kit :

- **Kits including:** ① Reservoir cap x 1
 - ③ M3x8 fixing screw x 2
- (2) Reservoir gasket x 1
- 4 Bleeding port screw with O-ring x 1

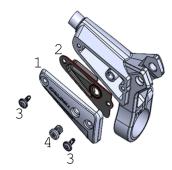

A. Removing reservoir top cap and gasket:

- 1. Loosen the bar clamp and rotate the lever on the bar until the reservoir is parallel with the ground to prevent the loss of oil.
- 2. Use a T15 torx wrench to remove the bleed port screw(4)
- 3. Use a T10 torx wrench to remove the two reservoir top cap screws③, then remove the top cap and gasket.

B. Installing new reservoir top cap and gasket:

- 1. Thoroughly clean the edge of the reservoir on the lever so that oil doesn't get trapped between it and rubber gasket.
- 2. Place the gasket 2 and reservoir top cap 1 onto the reservoir.
- 3. Loosely install the two fixing screws(3) then tighten to 0.8-1.2 Nm.
- 4. Install bleed port screw (4) then tighten to 0.8-1.2 Nm.

NOTE

- 1. The brake must be refilled mineral oil from caliper side for making sure brake performance.
- 2. Follow regular operation of hydraulic disc brake or refer to our Bleed Procedure instructions to bleed the brake.
- 3. Only use TRP and Tektro branded mineral oil when servicing the brake.
- 4. Use original specification spare parts for maintenance.
- 5. If any doubts, we recommend taking the bike to a Bosch ABS authorized dealer shop to check first

For warranty related questions or more information please contact Tektro Service Center which you can find from our homepage www.tektro.com.

Feb. 05,2 024